


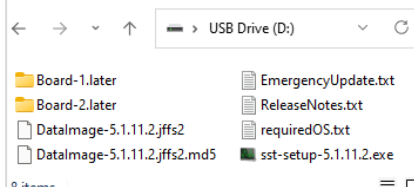


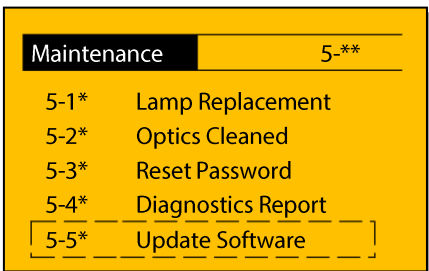
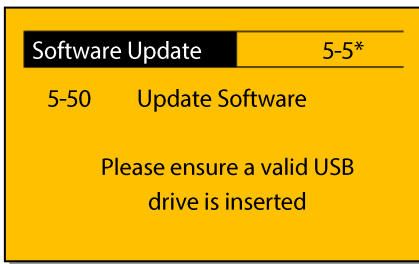
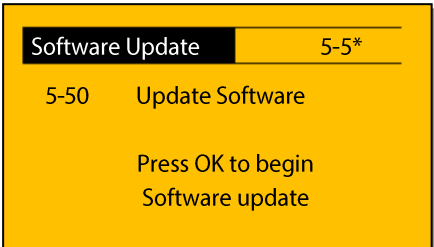
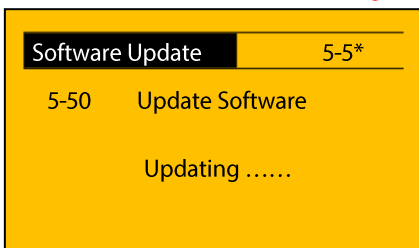
MES 1001 Software update guide

Document no.: 101455-MAN

Revision: A

Revision date: 2022-09

NOTICE Do NOT turn off sensor during SW update!

<p>1 Download latest version of SW at https://danfoss-ixa.com/services-and-support (use QR code for link)</p>		<p>2 Unpack zip-file and copy ALL files to root of empty USB drive</p> 
<p>3 Insert USB drive in sensor front panel (X31)</p>		<p>4 On sensor display (Local Control Panel), press "Menu" button. Navigate using up/down arrows and OK button.</p> 
<p>5 Go to 5-** Maintenance and 5-5* Update Software</p> 	<p>6 Press OK</p> 	
<p>7 Press OK</p> 	<p>8 Wait for sensor software to be updated. This step takes approx. 5 minutes. Follow status on progress bar. NB! Do NOT turn off sensor during this process</p> 	

NOTICE In case of error message "Storage media not found":

<p>1 Check that all files are unpacked and copied to root of USB drive</p>	<p>2 Ensure that USB capacity is not larger than 32 GB (Sensor only supports USB drives up to 32 GB)</p>
<p>3 Ensure that USB is formatted to use FAT32 file system</p>	<p>4 Check that USB is correctly inserted</p>
<p>5 Try with a different or new USB drive</p>	<p>6 If still not working, contact Danfoss IXA Service & Support at ixa.service@danfoss.com</p>